

marantz® SERVICE BULLETIN		Date: 27-Sep-2004	Model: CD5400
		Page: 1 / 1	REF.NBR: MZ04-064
Level		Application:	
★ ★ ★		See below	
		Subject: Capacitors change of the Power Supply.	
		Int.ref:	

[PHENOMENON]


Capacitors C903 and C904 may short-circuit very rarely.

[REASONS]

The shortage of voltage-proof of the capacitor.

[SOLUTION]

1. POS.NO **C903** and **C904** CAP,CERAMIC(0.1uF 50V) is changed to part no.**90M-DK100920R**(0.1uF 100V).

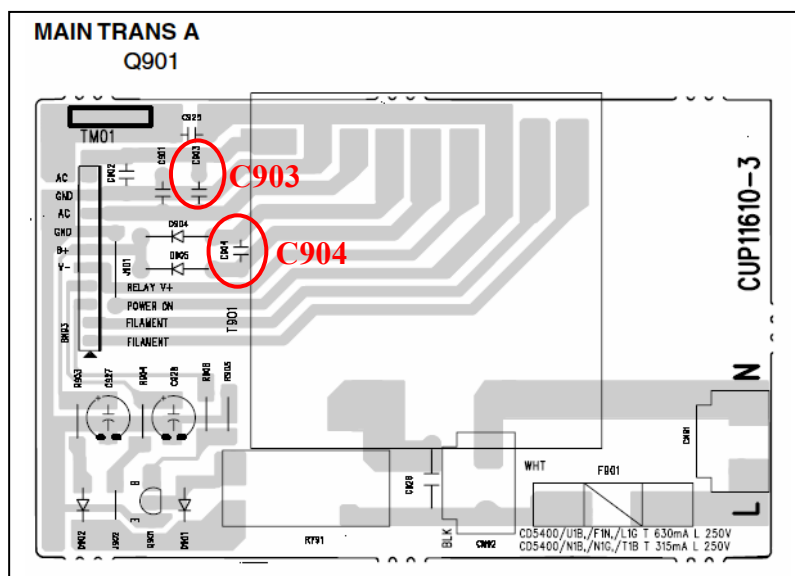

[NECESSARY PART]

POS.NO C903 / C904 **90M-DK100920R** (0.1uF 100V “Factory part no. CR051BX7R104K101F”)

[REMARKS]

1. This problem apply to the following week code.

CD5400 apply to MZ010425xxxxxx

2. This improvement has been done in the production week code MZ010426xxxxxx and after.

Approved by **S.NAGAO**

Written by