

marantz® SERVICE BULLETIN		Date: 22-Nov-01	Model: DV6200
		Page: 1/1	REF.NB MZ01-027
Circulation:		Subject:	
Application:		Improvement for selection the audio output while playback the VCD disc	
x for information customer complaint in case of service mandatory			
		MZxx0000xxxxxxx MZxx0146xxxxxxx	

[PHENOMENON]

When the VCD disc is played and then the AUDIO OUTPUT is selected by "AUDIO" button for the remote controller. It seems to be selected on screen and FLD. However the audio output is not changed.

[SOLUTION]

Update the firmware version from [1.0MP] to [2.07MP].
The way of firmware version up is as follows;

Connect the DVD player to [TV] and operate by using [Remote Controller]

- 1) Insert the update disc (Part No. *DV6200CDR) into the product.
- 2) FLD indicates [PrESS UP] when the disc is detected.
- 3) Press **▲(up)** button.
- 4) FLD indicates [rEAd 0]. If FLD indicated [rEAd 1] or other number, please refer to the following <Error message>.
- 5) FLD indicates [UPgrAdE 0]. After few minutes, FLD indicate [FinlSHed] and the tray will be opened automatically.
- 6) Remove the disc. Press **OPEN/CLOSE** button and the power will be turned off automatically.
- 7) The product should be confirmed the firmware version and be reset.
- 8) Press **POWER** button and press **SETUP** button.
- 9) Select "TV aspect" and press **▶(right)** button.
- 10) Press **▲(up)** button or **▼(down)** button and choose "16:9 wide".
Attention : Do not press **SELECT/ENTER** button (Keep green triangle mark)
If check mark is appeared, press **▶(right)** button and change to green triangle mark.
- 11) Enter the code number "1397139" by **Numeric buttons**.
- 12) Press **SELECT/ENTER** button.
The connected TV indicates "SYSTEM INFORMATION"
Please check "MICOM-VER" is "2.07MP".
If other number indicate, need to retry this procedure again.
- 13) Press **POWER** button and turn off the power.
"Update firmware" and "Reset" are succeeded.

Example indicated

```

SYSTEM INFORMATION
MODEL      : DV6200/U1B
REGION-NO  : 1
CHIP-ID    : PANTERA II
SERVO-VER  : b003
MICOM-VER  : V2.07 MP
PROM OPTION : XX XX XX XX XX XX

Factory Reset..Done

```

<Error message>

During reading the update disc, error messages are as follows

[Error Num] = 1 ~ 3

You can retry to upgrade by disc.
Because, flash ROM is not erased data yet.

[Error Num] = 4 ~

It is very worst case. The flash ROM is broken during erasing or programming.
You need to rewrite from hardware (PC) for using another jig.

[REMARK]

This improvement has been done in the production line after the production week code number "0147" and later. The production week code is mentioned in the serial number label on the rear panel. (ex. **MZxx0147xxxxxxx**)

marantz® SERVICE BULLETIN		Date: 15-May-2003	Model DV4200/DV6200
		Page: 1/1	REF.NBR: MZ02-025
Circulation:		Subject:	
Application:		Improvement for playability of DVD disc "Beauty and Beast" and subtitle problem with some disc	
x for information customer complaint in case of service mandatory			
		Before MZxx0249xxxxxx	

[PHENOMENON]

- 1) Sound skips and picture freeze 1 second at the chapter 8 with DVD disc "Beauty and Beast".
- 2) Subtitle will be ON automatically at the chapter 3 with DVD disc "SPY GAME".
- 3) Subtitle will be ON automatically at the 17'00" with DVD disc "The World is not Enough".

[SOLUTION]

Update the firmware version to [Ver.2.21MP].
The way of firmware version up is as follows;

Connect the DVD player to [TV] and operate by using [Remote Controller]

- 1) Insert the update disc (Part No. *DV4200CD3) into the product.
- 2) FLD indicates [PrESS UP] when the disc is detected.
- 3) Press button.
- 4) FLD indicates [rEAd 0]. If FLD indicated [rEAd 1] or other number, please refer to the following <Error message>.
- 5) FLD indicates [UPgrAdE 0]. After few minutes, FLD indicate [FinISHED] and the tray will be opened automatically.
- 6) Remove the disc. Press button and the power will be turned off automatically.
- 7) The product should be confirmed the firmware version and be reset.
- 8) Press button and press button.
- 9) Select "TV aspect" and press button.
- 10) Press button or button and choose "16:9 wide".
Attention : Do not press button (Keep green triangle mark)
If check mark is appeared, press button and change to green triangle mark.
- 11) Enter the code number "1397139" by Numeric buttons.
- 12) Press button.
The connected TV indicates "SYSTEM INFORMATION"
Please check "MICOM-VER" is "2.21MP".
If other number indicate, need to retry this procedure again.
- 13) Press button and turn off the power.
"Update firmware" and "Reset" are succeeded.

Example indicated

SYSTEM INFORMATION
MODEL : DVxxxx/xxx
REGION-NO :1
CHIP-ID :PANTERA II
SERVO-VER :b003
MICOM-VER V2.21 MP
PROM OPTION :XX XX XX XX XX XX
Factory Reset..Done

<Error message>

During reading the update disc, error messages are as follows

[Error Num] = 1 ~ 3
You can retry to upgrade by disc.
Because, flash ROM is not erased data yet.

[Error Num] = 4 ~
It is very worst case. The flash ROM is broken during erasing or programming.
You need to rewrite from hardware (PC) for using another jig.

[REMARK]

This improvement has been done in the production line after the production week code number "0250" and later. The production week code is mentioned in the serial number label on the rear panel. (ex. MZxx0250xxxxxx)

marantz® SERVICE BULLETIN		Date: 15-May.-2003	Model: DV4200,DV6200,VC5200
		Page: 1 / 1	REF.NBR: MZ02-037
Circulation:		Subject:	
Application:		Problem with playability of MP3 Disc and can not playback DVD disc "WALT DISNEY ATLANTIS.	
x for information customer complaint in case of service mandatory		Int.ref:	
See Below			

[PHENOMENON]

1. Can not playback by the some encoding software of the MP3 disc.
2. The black color of the video output is light.
3. Can not playback DVD disc "WALT DISNEY ATLANTIS.(Only U.S.A. "U1B" version occurs)

[SOLUTION]

Update firmware version to **[Ver.2.11MP and over]**

Firmware Update Procedure

DV4200 and DV6200----Refer to service manuals 2-8 pages "**How to upgrade by upgrade DISC**".

VC5200-----Refer to SERVICE BULLETIN MZ01-023 (22-Nov-01)

[NECESSARY PART]

Update firm ware (Ver2.21MP) Disc Part no. *DV4200CD3

[REMARKS]

The countermeasure apply to this claim only.

This solution has already been applied in the production line after the week code number "**MZ000206xxxxx**" and after.

The week code number are printed in the serial number label on the rear panel.
(ex.**MZxx0206xxxxx**)