

marantz® SERVICE BULLETIN		Date: 15-May.-2003	Model: SR110
		Page: 1 / 1	REF.NBR: MZ02-038
Circulation:		Application:	
x for information customer complaint in case of service mandatory		See Below	
		Subject: The problem that the character of the FL indication changes	
		Int.ref:	

[PHENOMENON]

The character of the FL indication changes when the power is turned on.

[SOLUTION]

Replace **C317(0.1uF/50V)** to **100pF/50V** on the **Front Circuit Board**

[NECESSARY PART]

POS.NO. **C317** **DD95103300 (CER.CHIP)**

[REMARKS]

The countermeasure apply to this claim only.

This solution has already been applied in the production after the serial numbers below.

SR110/N1S : MZ000119000131 and after

SR110/U1S : MZ000119000013 and after

Approved by **S.NAGAO**

Written by