

<b>marantz®</b> <b>SERVICE BULLETIN</b>		Date: 15-May.-2003	Model: SR5300,SR6300
		Page: 1 / 1	REF.NBR: MZ03-019
Circulation:		Application:	
x for information customer complaint in case of service mandatory .....		See Below	
		Subject: 1. Modify a part of the indication on display. 2. Cirrus DSP code change	
		Int.ref:	

**[PHENOMENON]**

1. A part of the modification item of SETUP MAIN MENU is the following.

OLD	→	NEW
<b>PL2</b>	→	<b>PLII</b>
<b>DTS ES</b>	→	<b>DTS ES Matrix/Diacrete</b>
<b>Neo6</b>	→	<b>Neo:6</b>

2. The problem of Speaker Distance center delay is modified.

**[SOLUTION]**

Replace MICRO PROCESSOR **IC107 on the MAIN PCB** and **IC704 on the DSP PCB**.  
MICRO PROCESSOR version becomes **V021125 01**

**[NECESSARY PART]**

POS.NO	<b>IC107</b>	<b>*HU100700R</b>	(CXP740010	Factory part no. J020740010173)
POS.NO	<b>IC704</b>	<b>*HC108450R</b>	(M27W401-80B6	Factory part no. J080493260030)

Old part				
POS.NO	IC107	*HU100610R	(CXP740010	Factory part no. J020740010163)
POS.NO	IC704	*HC107760R	(M27W401-80B6	Factory part no. J000274010010)

**[REMARKS]**

This improvement has been done in the production as follows.  
the serial no.MZ010307005811 and after (SR5300/N1B)  
the serial no.MZ010307004544 and after (SR5300/N1G)  
the serial no.MZ010307005811 and after (SR5300/U1B)  
the serial no.MZ010308004696 and after (SR5300/K1G)  
the serial no.MZ010308002489 and after (SR6300/N1B)  
the serial no.MZ010308002019 and after (SR6300/N1G)  
the serial no.MZ010309001808 and after (SR6300/K1G)

Approved by **S.NAGAO**

Written by

<b>marantz®</b> <b>SERVICE BULLETIN</b>		Date: 15-May.-2003	Model: SR7300,SR6300
		Page: 1 / 1	REF.NBR: MZ03-018
Circulation:		Application:	
x for information customer complaint in case of service mandatory .....		See Below	
		Subject: The problem that the remote controller can't learn other the remote controller .	
		Int.ref:	

**[PHENOMENON]**

When learning and memorizing the remote control codes used by Set-top Box of Time Warner Inc.,  
A part of cursor button can't be learned.

**[SOLUTION]**

RC7300SR is exchanged for the improvement the remote controller RC7300SRa.

**[NECESSARY PART]**

Improvement the remote controller part no. **ZK03AJ0012**

(SR6300: old remote controller part no. ZK15AW0010   FACTORY PART NO.8300030010010)  
(SR7300: old remote controller part no. ZK03AJ0010)



**Model name RC7300SRa**

**[REMARKS]**

The countermeasure apply to this claim only.

This solution has already been applied in the production line after the Lot number "MZxxxxxx27xxxx" and later.

The production of SR6300 has been finished.

Approved by **S.NAGAO**

Written by

<b>marantz®</b> <b>SERVICE BULLETIN</b>		Date: 15-May-2003	Model SR5300/SR6300
		Page: 1/1	REF.NBR:MZ03-007
Circulation:		Application:	
x for information customer complaint in case of service mandatory .....		See below	
		Subject:  Abnormal noise from speaker	
		Int.ref:	

[ PHENOMENON]

Abnormal noise appears from speaker after 10 minutes or so with digital input

[SOLUTION]

Replace DSP IC CS493263(IC709) to new type one (Parts No. **\*HC107260R**).

The countermeasure needs to apply to this claim only.

[REMARKS]

New IC has been applied in the production after the following serial number and after.

SR5300/N1G: MZ000241001962 and later  
SR5300/N1B: MZ000241002811 and later  
SR5300/U1B: MZ000242002611 and later  
SR5300/A1B: MZ000242000326 and later  
SR5300/K1G: MZ000242000979 and later  
SR6300/N1G: MZ000241000987 and later  
SR6300/N1B: MZ000241001139 and later  
SR6300/U1B: MZ000241000862 and later  
SR6300/K1G: MZ000242000361 and later