

McIntosh SERVICE BULLETIN

MA 6100
S.B. No. 1

WIRING CHANGE

MODEL: MA 6100 Preamp-Amplifier

PURPOSE OF MODIFICATION: To correct wiring error in compensation and tone controls.

WHAT UNITS ARE AFFECTED: Serial No. AE1001 to AE1184

WHEN MODIFICATION SHOULD BE MADE: Any time any other service is performed.

McINTOSH MODIFICATION KIT NO.: None

PARTS REQUIRED: None

PROCEDURE: (Refer to the diagram on reverse side)

- Step 1 Remove dust cover, knobs & front panel.
- Step 2 Interchange the orange and orange/white wires connected to the tone control PC Board.
- Step 3 Interchange the brown and brown/white wires connected to the tone control PC Board.
- Step 4 Remove 4 screws from upper section of sub panel and interchange the green and green/white wires connected to the volume control (R210).
- Step 5 Replace upper section of sub panel making sure to use the hex head screws in the top holes and the pan head screws in the lower holes . Replace front panel, knobs and dust cover.

BE042003

