



Technical Bulletin

C521BEE

Product: DVD Player

Hardware Technical Bulletin:C521BEE-H2005-04

Date: June 27/05

Subject: Laser ribbon cable

Note:

Previous T.B.'s required:

YES

NO

DESCRIPTION: You may have the complaint that some tracks skip or stops playing altogether.

REASON: The laser pick up connects to the main pc board via a flat ribbon cable and possibly is twisted the wrong way . It maybe getting caught on the fuse holders or other parts. just behind the transport mechanism . See figure 1.

SOLUTION: The ribbon cable needs to be allowed to wrap smoothly as shown in figure 2.

Contact:

NAD Electronics International

633 Granite Court

Pickering, ON Canada L1K 3K1


Voice: 905-831-0799 FAX 905-837-6357

www.nadelectronics.com

Product: DVD Player


Hardware Technical Bulletin: C521BEE-H2005-04

Figure 1

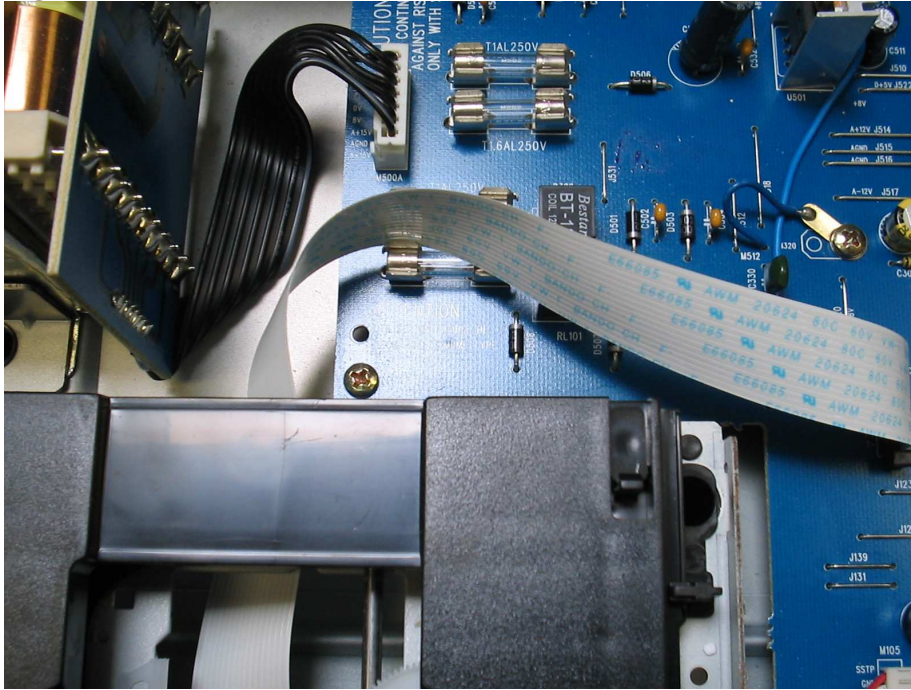

INCORRECT

Figure 2

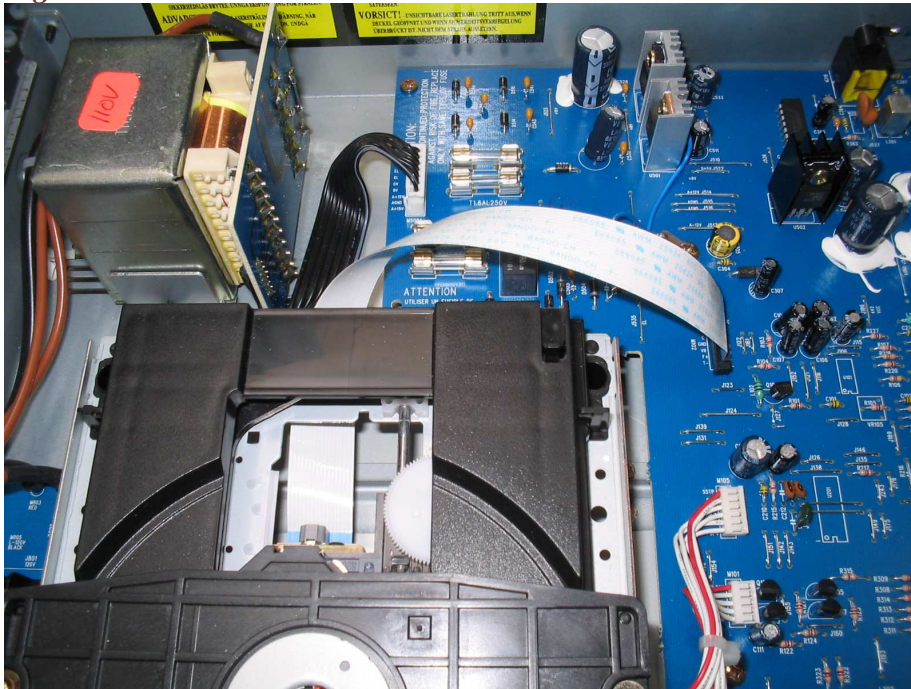

CORRECT