



Service C730

Information(revised)

Circuit Change

***PROBLEM:** Volume control has to be near maximum for full output on some inputs.*

***CAUSE:** Insufficient gain.*

***SOLUTION:** Increase the gain of the amplifier stage by 5dB . Replace R707,708 12k to 15k 1/8 w ,R803,804,823,824 from 18k to 20k 1/8 w and R825,826 from 680r to 470r 1/8w resistor. Decrease R975 on the tuner pcb to 15 k 1/8w resistor.*

Contact:

**NAD Electronics International
633 Granite Court
Pickering, ON Canada L1K 3K1
Voice: 905-831-0799 FAX 905-837-6357
NAD@www.NADelectronics.com**