

Ē

	Product: Int	egrated Amplifier	
	Hardware Technical Bulletin: C372-H2005-01		
Date:	June 1/05	Subject: Power supply capacitors	
Note:	Implemented in pr	Implemented in production from serial number: H54C37210151	
Previous T.B.'s required:			
	YES		
	NO		

DESCRIPTION: Please perform the following modification when in for service for any reason .Power supply capacitors maybe stressed(top of caps are expanded) due to insufficient soldering on pc board trace. A very small percentage of units are affected, but severe damage is possible due to the high voltage and current in this part of the circuit.

REASON:Solder pads around jumper wires have higher than normal resistance causing power supply ripple to increase across filter capacitors. See figure 1.

SOLUTION:Add 18 gauge wires to thePCB to lower the circuit resistance.To install this modification, first remove the bottom service plate. Look for the PCB area shown in figure 2. In figure 3, the addition of black jumper wires to lower the resistance of these pc board traces is shown. Capacitors showing any signs of stress or damage should also be replaced at the same time.

<u>Warning:</u> Check the correct polarity after performing this change. Use a variac to bring up supply voltage to ensure proper polarity. Failure to do this check could destroy capacitors!!

<u>Figure 1 (Original layout, showing cracked solder on jumper wire)</u>





Technical Bulletin C372

Product: Integrated Amplifier Hardware Technical Bulletin: C372-H2005-01

Figure 2

Area of PCB to be modified





Technical Bulletin C372

Product: Integrated Amplifier Hardware Technical Bulletin: C372-H2005-01

Figure 3

Addition of wires to PC Board area

Four wires shown below





Technical Bulletin C372

Product: Integrated Amplifier Hardware Technical Bulletin: C372-H2005-01



Contact: NAD Electronics International 633 Granite Court Pickering, ON Canada L1K 3K1 Voice: 905-831-0799 FAX 905-837-6357 www.nadelectronics.com

Negative supply , add this wire between these two pads