# **MODIFICATION**

## **PROBLEM:**

When the headphones are plugged in the subwoofer is not muting.


## CAUSE:

Mute line on subwoofer does not activate when the headphones are plugged in.

## **SOLUTION:**

The headphones, On line(h/p on) from the control (front panel) board can be connected via a wire and a 4.7k ohm resistor to the base of Q302 on the surround pc board. See diagram 1,2 and 3. Glue resistor to surround pc board after to prevent wire and resistor from moving.

# Diagram 1

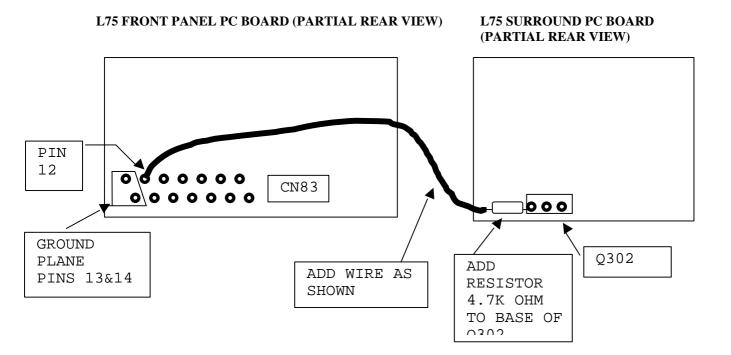



# Service Information L75

# **Circuit Change**

PROBLEM: Transformer buzzes.
CAUSE: Transformer's core is causing hum and is transferred to the chassis.
SOLUTION: Replace transformer with new low hum type. Install rubber padding on under side of transformer.
PRODUCTION:  This change has been implemented in production from serial number:A14L7502001

#### **Contact:**

NAD Electronics International 633 Granite Court Pickering, ON Canada L1K 3K1 Voice: 905-831-0799 FAX 905-837-6357 NAD@www.NADelectronics.com